

Manhole Inspection Summary

Manhole # S65O__017MH

Printed On: 9/17/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **65O** Node: **017** Status: **Found**

Insp Date: **5/12/08 3:15 PM**

Incomplete Comments

Crew: **MM,AA**
Inspector: **MikeMixer**
Firm: **RJN**

Location Address: **1320 Broening Hwy.**

Cross Street: **Boston St.**

Manhole Type: **Inline**

Location: **Sidewalk**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **Sheeting**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **7** Missing: **0** ☐ Corroded

Surcharge

☒ **Evidence Of Surcharge** Depth: **3** (ft.) ☐ Active Surcharge Present


Location View



Top View



Defect 4

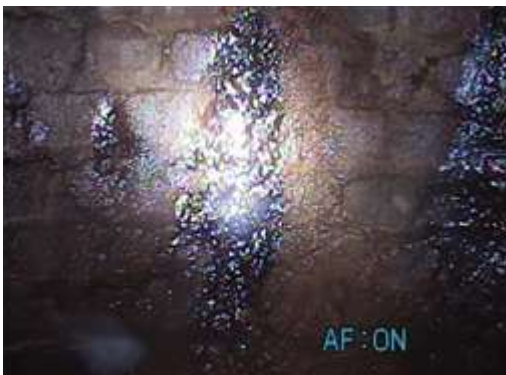

Infiltration in barrel wall

Defect 1



loose and cracked bricks at frame adjustment.

Defect 3



Infiltration evidence

Defect 2



Deterioration of the frame adjustment.

Manhole Inspection Summary

Manhole # S65O__017MH

Printed On: 9/17/2009

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **12.67** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☐ Gravy ☐ Debris ☒ Grease
Silt Depth: **0.125** (in.) Deposits Extent: **Light**
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **12.58** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☒ Gravy ☐ Debris ☒ Grease
Silt Depth: **0.25** (in.) Deposits Extent: **Light**
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection